



TO INFORM YOU

PRODUCT
SUPPORT
BULLETIN # 407

TO: AUTHORIZED *portable electric tool* SERVICE STATIONS
factory SERVICE / SALES SUPPORT BRANCH
SALES COMPANIES


DATE: August, 2003

TOOL(S) \ PRODUCT(S) AFFECTED:

48-05-1005 1-1/4" - 3" Sharp-Fire® Magazine

6708-20, 6708-51, 6708-56 1-1/4" - 3" Sharp-Fire® Screw-Shooter System


SUBJECT: difficulty driving 3" screw - 43-46-0208 Depth Control

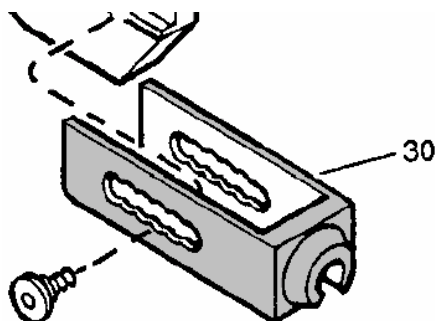

A running change has been made to the 43-46-0208 Depth Control Bracket [fig.30] adding roughly 5/64" of material (*see photo*) to the nose of the barcket to eliminate the problem with difficulty in driving 3" screws.

The difficulty being that the tip of a 3" screw comes in contact with the work surface before being properly positioned / aligned in the bracket, not allowing for a 3" screw to be driven into the work.

A 43-46-0208 Depth Control bracket with a 0.3140" nose height measurement should be replaced with a 0.3980" Depth Control bracket at no-charge - under warranty.

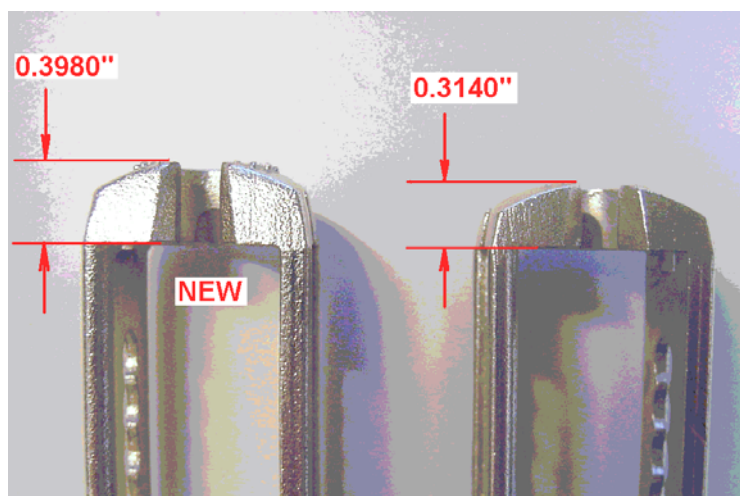

This bulletin is for informational purposes. PLEASE NOTE ON SERVICE PARTS LIST: 120V 54-42-5856, -6126; 240V 55-42-6125, -8075