



TO INFORM YOU

PRODUCT  
SUPPORT  
BULLETIN # 408

TO: AUTHORIZED *portable electric tool* SERVICE STATIONS  
*factory* SERVICE / SALES SUPPORT BRANCH  
SALES COMPANIES



DATE: September, 2003

TOOL(S) \ PRODUCT(S) AFFECTED: 1680-20 1/2" Super-Hawg® Drill

**SUBJECT: 23-66-2360 reversing switch failure - 42-38-0280 Rocker Boot**

Failure of a Super-Hawg® Drill's 23-66-2360 Reversing Switch Assembly can generally be traced to wood fibers entering the switch body and causing it not to work in one direction or the other. Rocker Boot 42-38-0280 is being added to seal off the reversing switch, preventing contamination from causing switch failure.

42-38-0280 Rocker Boot should be placed 'on' the face of a 23-66-2360 reversing rocker switch when any service is done on a 1/2" Super-Hawg® Drill's switch without a Rocker Boot as standard equipment.

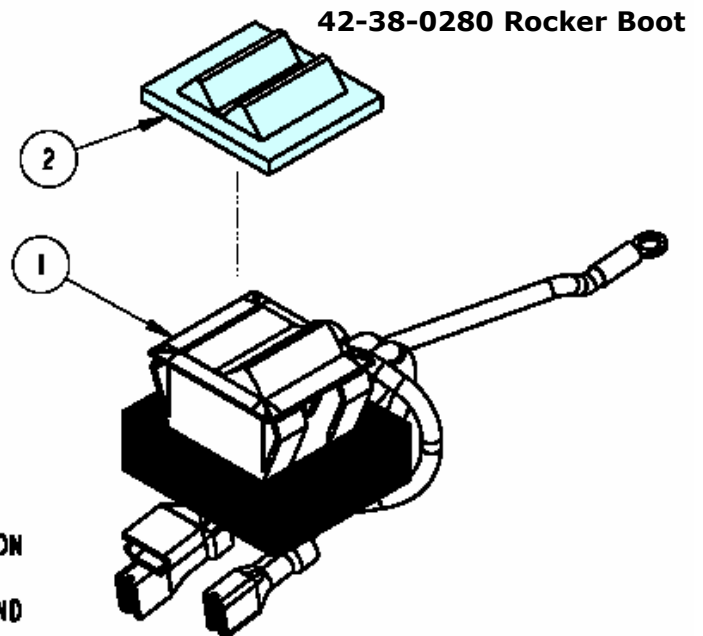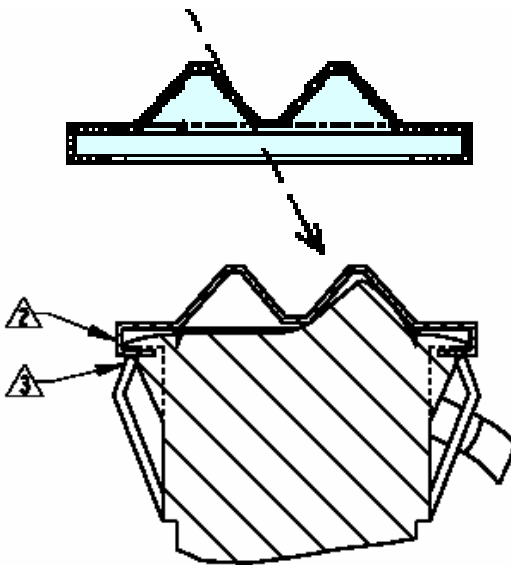

**NOTES:**

1. PLACE ROCKER BOOT OVER SWITCH IN ORIENTATION AS SHOWN.
2. HOOK LIP OF BOOT OVER LEDGE OF SWITCH AROUND ENTIRE PERIMETER OF SWITCH.
3. BOOT MUST BE FULLY SEATED UNDER ALL 4 SWITCH TABS.

This bulletin is for informational purposes. PLEASE NOTE ON SERVICE PARTS LIST: 120V 54-10-0250