

BULLETIN # 331

DATE: DECEMBER, 1998

TO: AUTHORIZED Portable Electric Tool SERVICE STATIONS

BRANCH OFFICE SERVICE CENTERS

SALES COMPANIES

FROM: Corbert A. Garb - National Service Manager

TOOL(S) \ PRODUCT(S) AFFECTED

5311, 5313-04, 5316, 5316-4, 5334, 5352, 5308-21, 5309-21, 5313-02 THUNDERBOLT[®] & THUNDERMAX™ **ROTARY HAMMER**


SUBJECT: 23-66-1930 120V Speed Control Switch

23-66-2420 240V Speed control Switch

WHEN SERVICING THE FOLLOWING SWITCH / TOOL:

- 23-66-1930 120V SPEED CONTROL SWITCH / 5311, 5316, 5334, 5352, 5308-21, 5309-21, 5313-02
- 23-66-2420 240V SPEED CONTROL SWITCH / 5313-04, 5316-4

Please insure that a 45-12-0540 FOAM SEAL is in place. In addition, it is recommended that after insertion of the lead wires, an electrical grade RTV Silicone Sealant (silica gel compound) be applied to the lead openings of the foam seal & switch body to prevent FINE drit & dust form entering the switch. (see illustration).

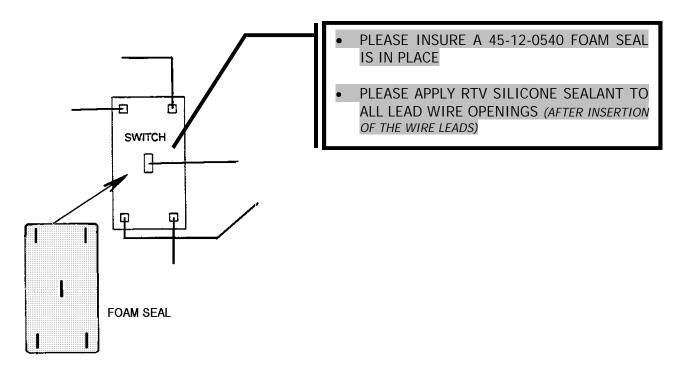

RTV Silicone Sealant is available as Service Part no. 44-22-0070.

SEE TO INFORM YOU / PRODUCT SUPPORT BULLETIN # 311

This bulletin is for informational purposes. PLEASE NOTE ON SERVICE PARTS LIST 54-24-0350, -0351, -0352, -0353, -0400, -0401, -0402, -0425, -0426, -0427, -0475, -0476, -0477, 0525, -0526, -1400, -1425, 55-24-0425, -0525