



TO INFORM YOU

PRODUCT  
SUPPORT  
BULLETIN # 363

**TO:** AUTHORIZED *Portable Electric Tool* SERVICE STATIONS  
factory SERVICE CENTERS  
SALES COMPANIES

**DATE:** APRIL, 2001

**FROM:** Corbert A. Garb - National Service Manager

**TOOL(S) \ PRODUCT(S) AFFECTED**

3002-1 RAD Electricians' Kit, 3102-6 RAD Plumbers' Kit, 3107-6 Variable Speed RAD Kit


3300-1 Magnum® Right Angle Drill Kit

48-06-2871 Right Angle Drive Assembly




**SUBJECT:** RAD – 38-50-2801 and 38-50-2951 spindle threads

**Undersize** spindle threads of the Right Angle Drive assembly can **cause strippage of the internal 'female' threads of a Chuck** and the external 'male' threads of the RAD spindle on a **corded** 1/2" 'D'-Handle Hole-Shooter™ Right Angle Drill when drilling 2-9/16" or larger holes.

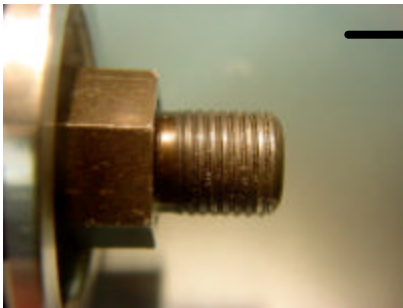

**Undersize** spindle threads will have  
a 'flattened' thread appearance

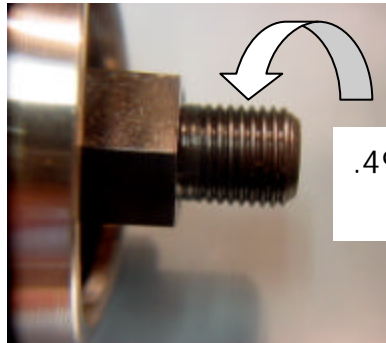

.490" is minimum 'major' [outside] thread  
diameter for a good spindle

This bulletin is for informational purposes. Please note on SERVICE PARTS LIST; Domestic 120V 54-06-0162, 54-08-1154, -1220, -2126, 54-36-0601