



TO: AUTHORIZED *Portable Electric Tool* SERVICE STATIONS
factory SERVICE CENTERS
SALES COMPANIES

DATE: June, 2001

FROM: Corbert A. Garb - National Service Manager

TOOL(S) \ PRODUCT(S) AFFECTED

9070-20, 9071-20, 9075-20 1/2" Impact Wrench manufactured between March and June, 2001

SUBJECT: 31-17-0265 Cord Clamp - Cord Field Lead wire connector disconnected


To improve cord retention in 9070-20, 9071-20, 9075-20 1/2" Impact Wrench original equipment 31-17-0265 Cord Clamp is being replaced by 31-17-0270 Cord Clamp.

Service Note: A tool received with White Cord - Field lead wire / Field connector being disconnected is an indication of cord moving in the clamp.


Clamping rib of the 31-17-0270 Cord Clamp is slightly larger and offers improved holding of the cord in the handle.

All 9070-20 below serial number **229A4012540722**, 9071-20 below serial number **230A401260104** and 9075-20 below serial number **239A401250404** received for repair should have a 31-17-0270 Cord Clamp installed.

31-17-0265 Cord Clamp has other usage and will remain a saleable service replacement part.

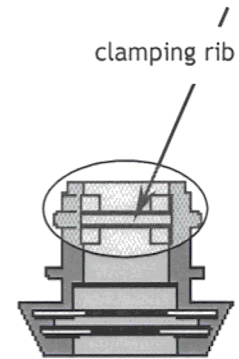

As an aid in determining the cord clamp in a tool, the 31-17-0270 Cord Clamp has the numbers '0270' molded into the clamping rib. The 31-17-0265 Cord Clamp has no markings on the rib.

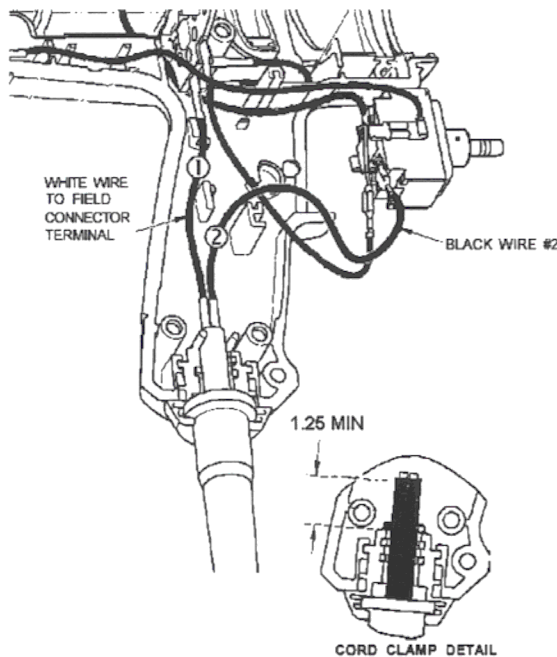

Wiring specification has been modified increasing the length of cord inserted through the strain relief, cord clamp and into the handle from .25" pass top of cord clamp to 1.25" [see illustration].

This bulletin is for informational purposes. PLEASE NOTE ON SERVICE PARTS LIST; 54-26-1700, -1725, -1775