**BULLETIN** # 371

**DATE**: July, 2001

riaht side

remove

loosen 14'

only

**TO:** AUTHORIZED Portable Electric Tool SERVICE STATIONS


factory SERVICE CENTERS SALES COMPANIES

FROM: Corbert A. Garb - National Service Manager

TOOL(S) \ PRODUCT(S) AFFECTED

9070-20, 9071-20, 9075-20 Impact Wrench

**SUBJECT:** 31-17-0270 Cord Clamp Replacement Instructions -

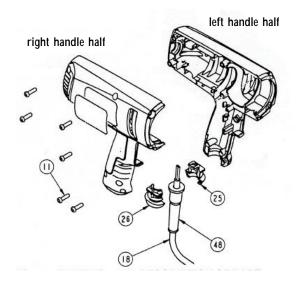

- 1. Separate handle halves by removing six [6] T-20 Torx head screws [fig 11] from the right handle half.
- 2. Note! Only remove the two [2] T-20 Torx head Front Housing / Gearcase screws [fig 10] on the right side. Loosen the two [2] left side screws a maximum of 1/4", leaving them in position to hold the Front Housing / Gearcase in place.
- Pry the Front Housing / Gearcase forward 1/4" maximum, allowing for the right handle half to be removed.
- 4. Make note of wire routing [see Wiring Instructions 58-01-1820].
- 5. Remove original equipment cord clamp [fig 26] found in the right handle half replacing it with a 31-17-0270 Cord Clamp. 31-17-0270 Cord Clamp has the numbers '0270' molded into it's clamping rib.

6. Reposition the cord protector [fig 48] & cord body [fig 18] in the left handle half increasing the length of cord inserted through the cord protector [strain relief], cord clamp and into the cavity of the handle from .25" beyond top of cord clamp to 1.25". Note: cord clamp assembly of the Impact Wrench is a two piece design, consisting of a 31-17-0260 Cord Clamp with posts [see illustration] assembled in the Left Handle Half and the 31-17-0270 Cord Clamp assembled in the Right Handle Half. [Check for proper repair, tugging on the cord after assembly will insure the cord clamp assembly is correct and that the cord set does not easily pull through the clamp.]

31-17-0260 Cord Clamp w/ posts

- 7. Reposition right handle half and verify wire routing, being careful not to pinch any wires [see Wiring Instructions].
- 8. Re-install Front Housing / Gearcase.
- 9. Tighten six [6] T-20 Handle and four [4] T-20 Front Housing screws until they are 'vigorously hand-tight'.



2

tighten bottom screw first [1], then top [2], then two rear screws and lower handle / cord clamp screws

Please see To Inform You/ Product Support Bulletin #358, 370.

This bulletin is for informational purposes. PLEASE NOTE ON SERVICE PARTS LIST; 54-26-1700, -1725, -1775