



TO INFORM YOU

PRODUCT
SUPPORT
BULLETIN # 457


TO: AUTHORIZED *Portable Electric Tool* SERVICE STATIONS
factory SERVICE / SALES SUPPORT BRANCH CENTERS

DATE: August 2006

TOOL(S) \ PRODUCT(S) AFFECTED: 0724-20 ½" V28 Hammer-Driver/Drill

SUBJECT: rubber spacer attached to 23-66-1779 Service Switch

23-66-1779 is now supplied with a rubber spacer attached to the copper heat sink to reduce vibration to internal switch contacts when installed in an Impact Wrench. The rubber spacer should be removed before installing the switch into a 0724-20 ½" V28 Hammer-Driver/Drill; if the rubber spacer is not removed a slight gap in the handle halves will occur.

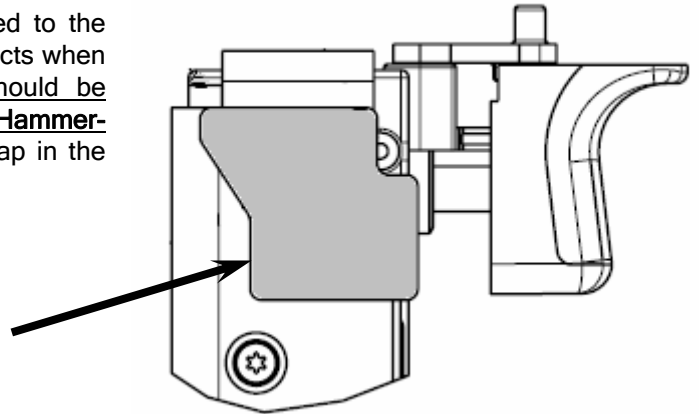

To reduce high vibration loads to internal switch contacts the rubber spacer is required when installing the -1779 Switch into a 0779-20, 0779-50 or 0799-20 ½" V28 Impact Wrench.

This bulletin is for informational purposes. PLEASE NOTE ON SERVICE PARTS LIST: 54-24-7010, 54-26-7000, 54-26-7010, 55-26-7000