

PRODUCT SUPPORT BULLETIN # 480

DATE: April, 2008

TO: AUTHORIZED portable electric tool SERVICE STATIONS


factory SERVICE / SALES SUPPORT BRANCH

TOOL(S) \ PRODUCT(S) AFFECTED: 5616-20, 5616-29, 2-1/4 HP BodyGrip® Router, 5625-20, 5625-29 3-1/2 HP


Production Routers and 6538-21 Super Sawzall®

SUBJECT: orientation of Tachometer - 23-38-0200

ROUTER INSTALLATION -

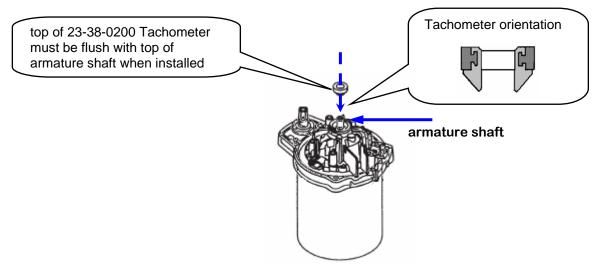

tachometer must be installed flush to the top of the armature shaft and in the proper orientation; if installed incorrectly tool's speed and performance will be compromised note: tachometer can be pushed sub-flush on shaft of Router armature

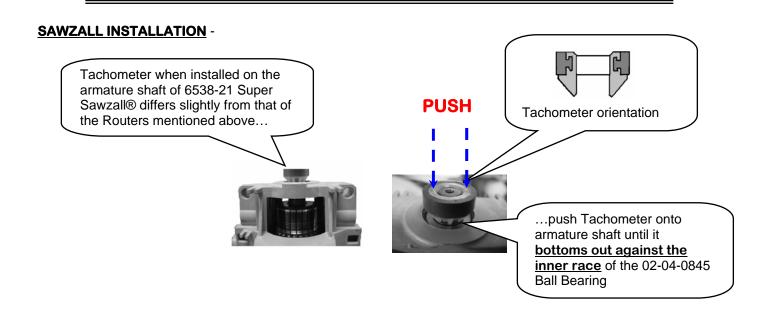

This bulletin is for informational purposes. PLEASE NOTE ON SERVICE PARTS LIST: 54-37-0175, 54-37-0225, 54-37-0250, 54-40-7570