



TO INFORM YOU

PRODUCT SUPPORT BULLETIN # 334

**TO:** AUTHORIZED *Portable Electric Tool* SERVICE STATIONS  
BRANCH OFFICE SERVICE CENTERS  
SALES COMPANIES

**DATE:** JULY, 1999

**FROM:** Corbert A. Garb - National Service Manager


**TOOL(S) \ PRODUCT(S) AFFECTED**

6223 Two Speed BANDSAW, with Starting Serial Number 822B  
6225 Two Speed BANDSAW, with Starting Serial Number 457B  
6227 Speed Control BANDSAW, with Starting Serial Number 674B


**SUBJECT: Correction to Service Parts List Bulletin 54-40-0051, 54-40-0117 & 54-40-1211**

6223, 6225 & 6227 BandSaws with starting Serial Number 457**B**, 674**B** or 822**B** have a potential to contain a 'one piece' Worm Drive Shaft (*see illustration*) versus the 'two piece' Worm & Worm - Drive Shaft as shown on the Service Parts List Bulletin.

Some 6223, 6225 & 6227 BandSaws within the '**B**' series were produced with a 'one piece' Worm Drive Shaft 36-18-0041.

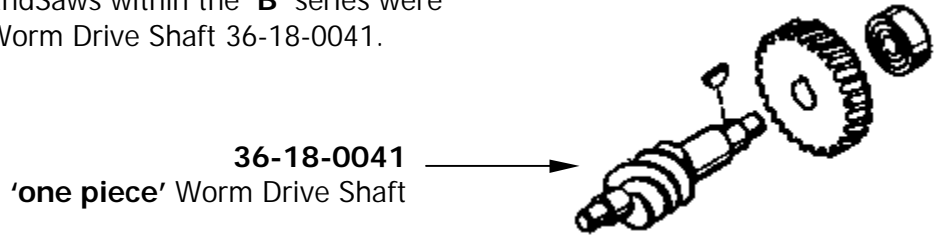

54-40-0051, -0117 & -1211 Service Parts List Bulletins call out the 'two piece' the 32-91-0115 Worm and 36-18-0040 Worm Drive Shaft.

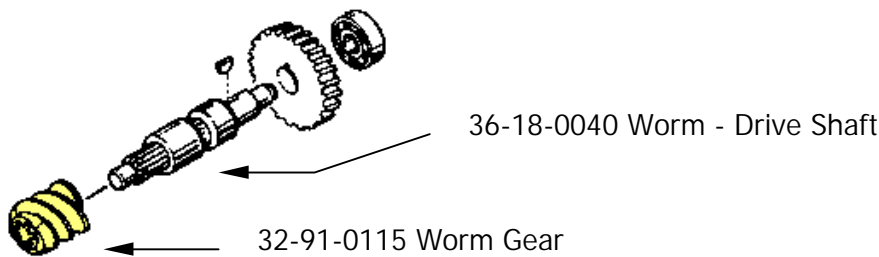

Please Note! 36-18-0040 Worm Gear Shaft is 'OBSOLETE – replaced by' the 36-18-0041 'one piece' Worm - Drive Shaft. The 32-91-0115 remains a 'saleable' Service Replacement Part for use in 6225, 6227 BandSaws and 6377, 6378, 6387, 6388 7-1/4" Worm Drive Saws.

This bulletin is for informational purposes; PLEASE NOTE ON SERVICE PARTS LIST BULLETIN: DOMESTIC, 54-40-0051, -0117, & -1211