
WIRING INSTRUCTIONS

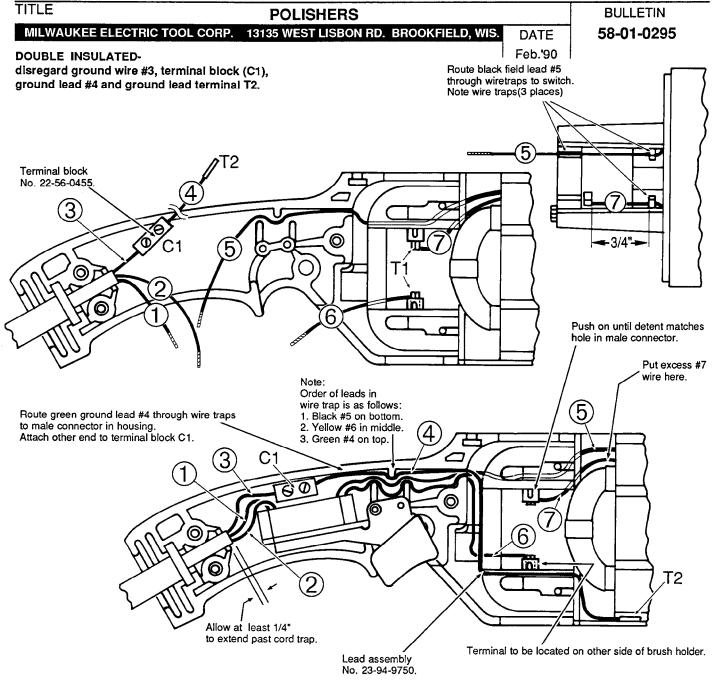

WIRING SPECIFICATIONS						
Wire No.	Wire Color	Origin or Gauge	Length	Terminals, Connectors and 1 or 2 End Wire Preparation		
1	Black	Cord	1-1/2"	Strip 3/8" And Tin.		
2	White	Cord	1-1/2"	Strip 3/8" And Tin.		
3	Green	Cord	1-1/2"	Strip 3/16" And Tin For C1.		
4	Green	23-94-9750	9"	Strip 3/16" For T2.		
				Strip 3/16" And Tin For C1.		
5	Black	Field	7"	Strip 3/8" And Tin.		
6	Yellow	Brush	7"	Strip 3/8" And Tin / Strip 1/8" For T1.		
7	Yellow	Field	1-3/4"	Strip 1/8" For T1.		

NOTE: All leads must be held to ± 1/8". All field leads to be measured from and perpendicular to laminations. All lead lengths are before stripping.

TERMINAL DESCRIPTION						
Code	Part No.	Qnty.				
T1 T2	23-74-0750 23-74-0810	2				
CONNECTOR DESCRIPTION						
C1	22-56-0455	1				