

WIRING INSTRUCTIONS

TITLE

IMPACT WRENCH

MILWAUKEE ELECTRIC TOOL CORP.


13135 WEST LISBON RD. BROOKFIELD, WIS.

DATE
May '74

BULLETIN

58-01-0525

Note: Any slack in brush wires should be tucked in between frame & field.

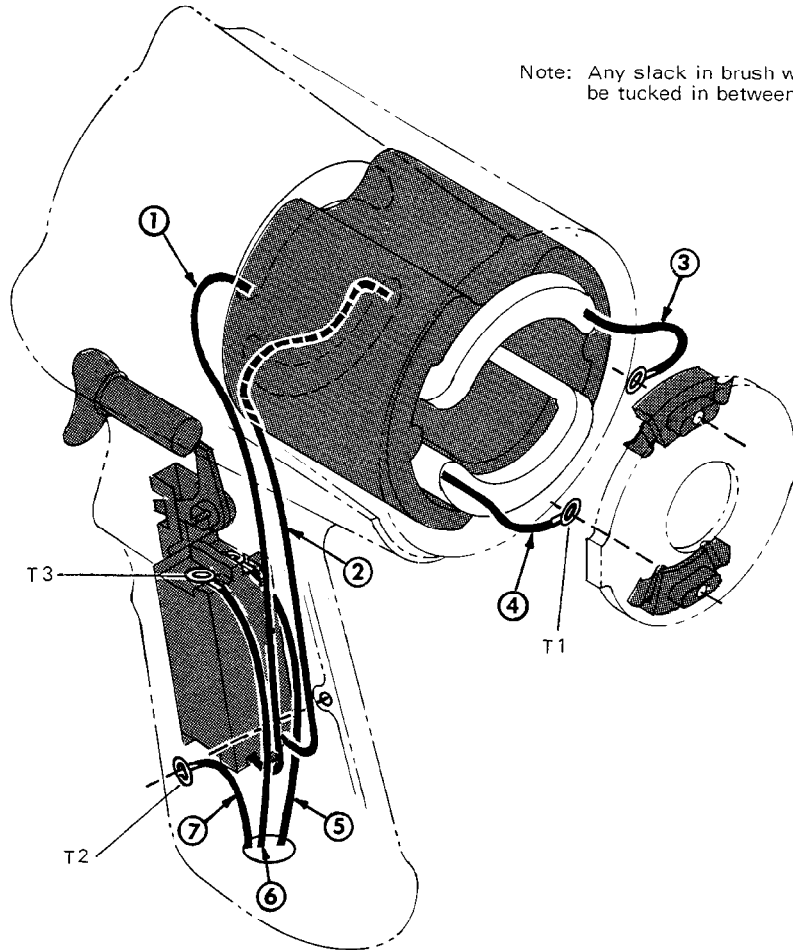

Refer to electrical parts chart for terminal and connector part nos.
and quantity required – see drawing for actual hook-up.

NOTE:

All leads must be held to $\pm 1/8"$.
All field leads to be measured from
and perpendicular to laminations.
All lead lengths are before stripping.

WIRING SPECIFICATIONS

Wire No.	Wire Color	Origin or Gauge	Length	Terminal				Connector			
				T1	T2	T3	T4	C1	C2	C3	C4
1	Black	Field	7-1/2			X					
2	Black	Field	7			X					
3	Black	Field	3	X							
4	Black	Field	3	X							
5	Black	Cord	2-5/8			X					
6	White	Cord	2-5/8			X					
7	Green	Cord	2-5/8		X						

ELECTRICAL PARTS

TERMINAL DESCRIPTION

Code	Part No.	Qty.
T1	23-74-0500	2
T2	23-74-0050	1
T3	23-74-0390	4

CONNECTOR DESCRIPTION

Code	Part No.	Qty.

SWITCH DESCRIPTION

Code	Part No.	Qty.
S1	23-66-0585	1