

WIRING INSTRUCTIONS

TITLE


SIDE HANDLE PISTOL DRILLS

MILWAUKEE ELECTRIC TOOL CORP.


13135 WEST LISBON RD. BROOKFIELD, WIS.

Date
Oct. '69

BULLETIN
58-01-0570

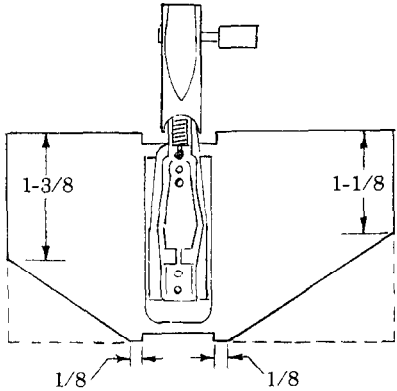

TRIM BOTTOM OF INSULATING
PAPER TO CLEAR CORD LEADS

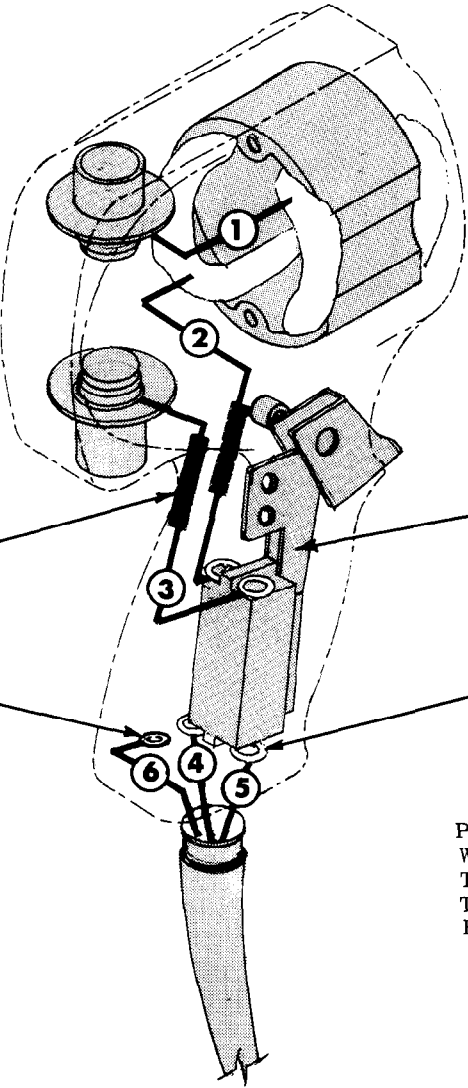

ANY SLACK IN WIRE NO.1
SHOULD BE PUSHED ABOVE
THE TOP BRUSH HOLDER
WASHER.

SLEEVING
23-48-7326

USE LOCK WASHERS UNDER
ALL SWITCH TERMINALS.

PLACE INSULATING SLEEVING ON
WIRES NO.2 AND NO.3 TO PROTECT
THE WIRES FROM THE EDGE OF
THE OPENING IN THE MOTOR
HOUSING.

Note...
Cord Leads on 0371 are as Follow s..

Black 2-3/4
White 2-3/4
Green 2-3/4

WHERE TERMINAL AND CONNECTOR COMBINATIONS ARE SPECIFIED, SEE ELECTRICAL PARTS CHART
FOR PART NO. AND QUANTITY AND DRAWING FOR ACTUAL HOOK-UP

WIRING SPECIFICATIONS

Wire Color	Wire No.	Ga.	Lgth. in.	Terminal				Connector				Wire Color	Wire No.	Ga.	Lgth. in.	Terminal				Connector			
				T1	T2	T3	T4	C1	C2	C3	C4					T1	T2	T3	T4	C1	C2	C3	C4
Blue	1	Fld.	1-3/8																				
White	2	Fld.	4	X																			
Blue	3	20	4	X																			
Black	4	Cord	2-1/2	X																			
White	5	Cord	2-1/2	X																			
Green	6	Cord	2-1/2		X																		

NOTE:
ALL LEADS MUST BE HELD TO ± 1/8"
ALL FIELD LEADS TO BE MEASURED FROM
AND PERPENDICULAR TO LAMINATIONS.
ALL LEAD LENGTHS ARE BEFORE STRIPPING.

Electrical Parts

TERMINAL DESCRIPTION

Code	Part No.	Qty.
T1	23-74-0330	4
T2	23-74-0050	1

CONNECTOR DESCRIPTION

Code	Part No.	Qty.

SWITCH DESCRIPTION

Code	Part No.	Qty.
S1	23-66-0160	1