
WIRING INSTRUCTIONS

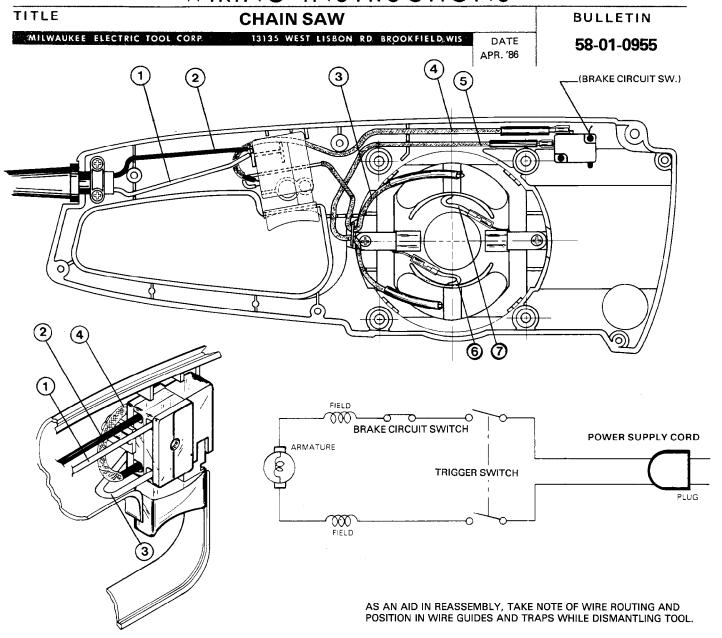

WIRING SPECIFICATIONS						
Wire No.	Wire Color	Origin or Gauge	Length	Terminals, Connectors and 1 or 2 End Wire Preparation		
1	WHITE	CORD	3-1/2 ± 1/8	1/2" STRIP AND TIN		
2	BLACK	CORD	3-1/2 ± 1/8	1/2" STRIP AND TIN		
3	WHITE	FIELD	11 <u>±</u> 1/8	1/2" STRIP AND TIN		
4	BLACK	JUMPER	_	T1-3/8" STRIP AND TIN		
5	YELLOW	FIELD	_	T1-3/8" STRIP AND TIN		
6	WHITE	FIELD	_	T2-3/8" STRIP AND TIN		
7	WHITE	FIELD	_	T2-3/8" STRIP AND TIN		

NOTE:

All leads must be held to ± 1/8".
All field leads to be measured from and perpendicular to laminations.
All lead lengths are before stripping.

TERMINAL DESCRIPTION						
Code	Part No.	Qnty.				
T1 T2	AMP 3-350816-2 AMP 3-350820-2	1 1				
CONNECTOR DESCRIPTION						
Code	Part No.	Qnty.				
05.0						