WIRING INSTRUCTIONS


TITLE

DOUBLE REDUCTION "D"HANDLE TOOLS

MILWAUKEE ELECTRIC TOOL CORP.

13135 WEST LISBON RD. BROOKFIELD.WIS

DATE Sept. '78 BULLETIN 58-01-0182

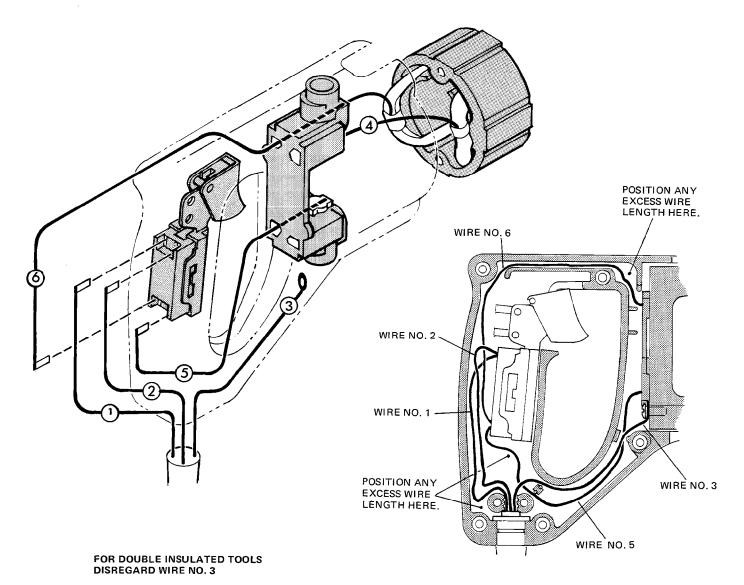

WIRING SPECIFICATIONS						
Wire No.	Wire Color	Origin or Gauge	Length	Terminals, Connectors and 1 or 2 End Wire Preparation.		
1	Black	Cord	4-3/4"	Strip 1/4" for T1		
2	White	Cord	4-3/4"	Strip 1/4" for T1		
3	Green	Cord	4-3/4''	Strip 3/16" for T2		
4	Brown	Field	2-1/4"	Strip 1/4" for T1		
5	White	18	8-3/4"	Strip 1/4" for T1/Strip 1/4" for T1		
6	Red	Field	10"	Strip 1/4" for T1		

NOTE:

All leads must be held to ± 1/8".
All field leads to be measured from and perpendicular to laminations.
All lead lengths are before stripping.

TERMINAL DESCRIPTION						
Code	Part No.	Qnty.				
Т1	22-44-0090	6				
T2	23-74-0390	1				
CONNECTOR DESCRIPTION						
Code	Part No.	Qnty:				