



TO INFORM YOU

PRODUCT
SUPPORT
BULLETIN # 332

TO: AUTHORIZED *Portable Electric Tool* SERVICE STATIONS
BRANCH OFFICE SERVICE CENTERS
SALES COMPANIES

DATE: FEBRUARY, 1999


FROM: Corbert A. Garb - National Service Manager

TOOL(S) \ PRODUCT(S) AFFECTED

120VAC - 6072, 6075, 6076, 6078 13AMP SANDER/GRINDERS
6065, 6066, 6067, 6068, 6070, 6095, 6096, 6098 7"/9" 15AMP SANDER/GRINDER

SUBJECT: GEAR TRAIN SLIPPAGE - 06-57-0500 1/4"-28 LOCK NUT

IMPORTANT! THIS SERVICE BULLETIN COVERS ALL 7" & 9", 13 & 15 AMP SANDER/GRINDERS USING EITHER THE **16-50-1185** OR **16-70-0300** 120 VOLT ARMATURE AND 06-57-0500 1/4"-28 ARMATURE PINION LOCK NUT (*see TO INFORM YOU / PRODUCT SUPPORT BULLETIN # 298 , # 314 and #318).

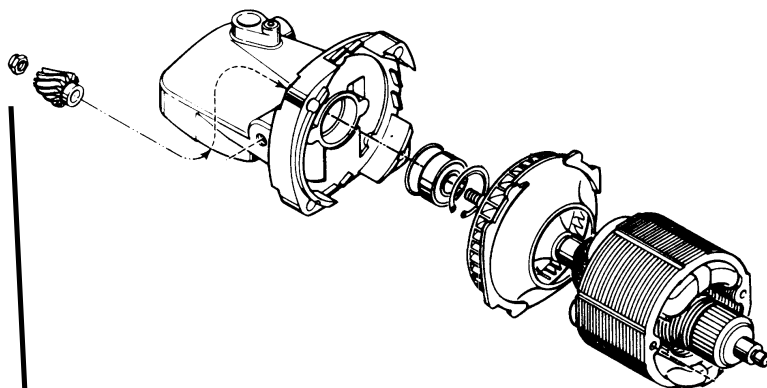

DURING SERVICE AND RE-ASSEMBLY OF SANDER/GRINDER, 06-57-0500
1/4"-28 ARMATURE PINION LOCK NUT SHOULD BE TIGHTENED TO
125-135 IN-LBS. OF TORQUE

NO THREAD ADHESIVE SEALANT IS REQUIRED

This bulletin supersedes PRODUCT SUPPORT BULLETIN #318

This bulletin is for informational purposes. PLEASE NOTE ON SERVICE PARTS LIST: DOMESTIC 54-38-0026, -0051, 0286, -0311, -0332, -0341 -0342, -0350, -0351, -0352, -0364, -0376, -0372, -0381, -0382, -0700, -0750, -0800