



TO INFORM YOU

**PRODUCT
SUPPORT
BULLETIN # 502**


TO: AUTHORIZED *portable electric tool* SERVICE STATIONS
factory SERVICE CENTERS

DATE: November, 2009

TOOL(S) \ PRODUCT(S) AFFECTED: 48-08-0550 MITER SAW STAND

SUBJECT: 'after mounting a miter saw to the table it will not swing fully to the left or right'

Eliminating the flat washer under the head of the two front side mounting bolts — using only the bolt & lock washer - allows the bolt and lock washer to drop down into the bolt recess; this then allows the miter saw table to complete a full swing to the right or left.

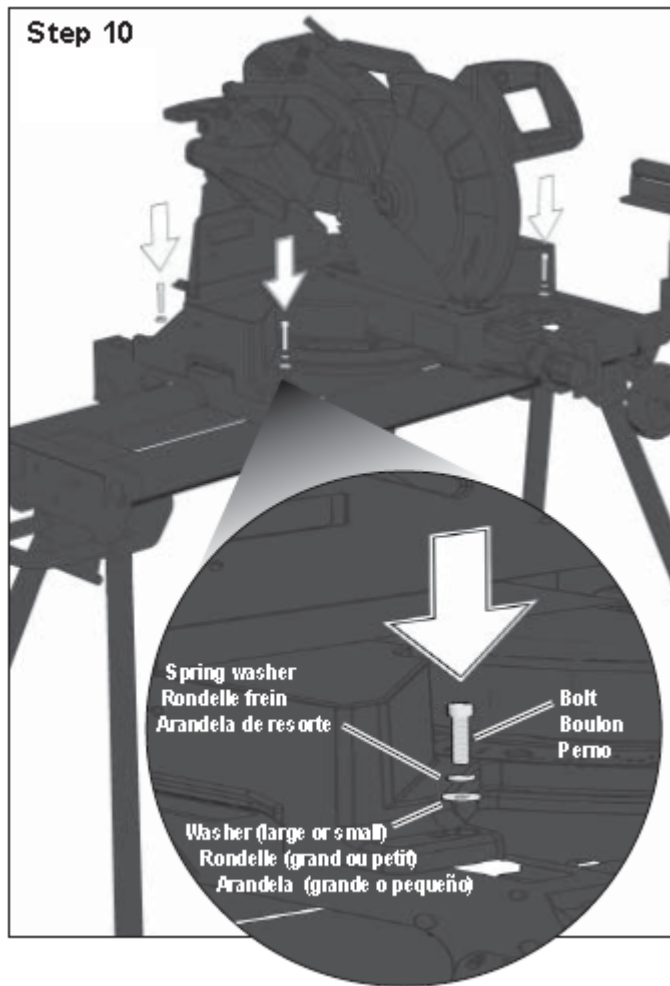

This bulletin is for informational purposes. PLEASE NOTE ON SERVICE PARTS LIST: 54-40-5455

MILWAUKEE ELECTRIC TOOL CORPORATION
13135 WEST LISBON ROAD • BROOKFIELD, WISCONSIN 53005 USA
262.781.3600